# New Hampshire Volunteer Lake Assessment Program

## 2002 Interim Report for Stone Pond Marlborough



NHDES Water Division Watershed Management Bureau 6 Hazen Drive Concord, NH 03301



## Observations & Recommendations

After reviewing data collected from **STONE POND**, the program coordinators recommend the following actions.

Please remember that the Franklin Pierce College Water Quality Lab is open at the college in Rindge. This lab was established to reduce the driving time for the VLAP monitors in the southwestern region of the state. This lab is inspected by DES and operates under a DES approved quality assurance plan. We encourage the lake association to utilize this lab next summer for all sampling events.

#### FIGURE INTERPRETATION

Figure 1 and Table 1: The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the lake/pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a and are naturally found in lake ecosystems, the chlorophyll-a concentration found in the water gives an estimation of the concentration of algae or lake productivity. The mean (average) summer chlorophyll-a concentration for New Hamsphire's lakes and ponds is 7.02 ug/L.

Similar to the summer of 2001, the summer of 2002 was filled with many warm and sunny days and there was a lower than normal amount of rainfall during the latter-half of the summer. The combination of these factors resulted in relatively warm surface waters throughout the state. The lack of fresh water to the lakes/ponds reduced the rate of flushing which may have resulted in water stagnation. Due to these conditions, many lakes and ponds experienced increased algae growth, including filamentous green algae (the billowy clouds of green algae typically seen floating near shore), and some lakes/ponds experienced nuisance cyanobacteria (blue-green algae) blooms.

The current year data show that the chlorophyll-a concentration in August was *elevated* and *slightly greater than* the state median. However, the elevated chlorophyll did not appear to affect the clarity in the pond.

The historical data (the bottom graph) show that the 2002 chlorophyll-a mean was **less than** the state mean. Overall, visual inspection of the historical data trend line (the bottom graph) shows **a** variable, but overall increasing (meaning worsening), in-lake chlorophyll-a trend since monitoring began in 1989.

For the 2003 annual report, since the pond will have been sampled fro at least 10 consecutive years, we will conduct a statistical analysis of the data. This will allow us to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration since monitoring began.

While algae are naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Therefore, algal concentrations may increase when there is an increase in nonpoint sources of nutrient loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). It is important to continually educate residents about how activities within the watershed can affect phosphorus loading and lake quality.

Figure 2 and Table 3: The graphs in Figure 2 (Appendix A) show historical and current year data for lake/pond transparency. Table 3 lists the maximum, minimum and mean transparency data for each sampling season that the lake/pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.

Two different weather related patterns occurred this past spring and summer that influenced lake quality during the summer season.

In late May and early June of 2002, numerous rainstorms occurred. Stormwater runoff associated with these rainstorms may have increased phosphorus loading, and the amount of soil particles washed into waterbodies throughout the state. Some lakes and

ponds experienced lower than typical transparency readings during late May and early June.

However, similar to the 2001 sampling season, the lower than average amount of rainfall and the warmer temperatures during the latter-half of the summer resulted in a few lakes/ponds reporting their best-ever Secchi-disk readings in July and August (a time when we often observe reduced clarity due to increased algal growth)!

The historical data (the bottom graph) show that the 2002 mean transparency is **approximately 2.5 meters greater than** the state mean. It is worthy to note that the annual mean this season is the second greatest annual mean since monitoring began.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a slightly increasing (meaning improving)** trend for in-lake transparency.

As discussed previously, for the 2003 annual report we will conduct a statistical analysis of the data to objectively determine long-term lake quality trends.

Typically, high intensity rainfall causes erosion of sediments into the lake/pond and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, lake/pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the lake/pond. Guides to Best Management Practices designed to reduce, and possibly even eliminate, nonpoint source pollutants are available from NHDES upon request.

Figure 3 and Table 8: The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the lake/pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a lake/pond can lead to increases in plant and algal growth over time. The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The historical data for the epilimnion (upper layer) show that the 2002 total phosphorus mean is **much less than** the state median.

Overall, visual inspection of the historical data trend line for the epilimnion shows **a stabilizing** trend which is **much less than** the state median. We hope this trend continues!

The historical data for the hypolimnion (lower layer) show that the 2002 total phosphorus mean is **slightly less than** the state median. Overall, visual inspection of the historical data trend line for the hypolimnion shows **a slightly increasing (meaning worsening)** total phosphorus trend since monitoring began.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands. If you would like to educate watershed residents about how they can help to reduce phosphorus loading into the lake/pond, please contact the VLAP Coordinator.

#### TABLE INTERPRETATION

#### > Table 2: Phytoplankton

Phytoplankton populations undergo a natural succession during the growing season (Please refer to page 12 of the "Biological Monitoring Parameters" section of this report for a more detailed explanation regarding seasonal plankton succession). Diatoms and golden-brown algae are typical in New Hampshire's less productive lakes and ponds. An overabundance of cyanobacteria (previously referred to as bluegreen algae) indicates that there may be an excessive total phosphorus concentration in the lake/pond, or that the ecology is out of balance. Some species of cyanobacteria can be toxic to livestock, pets, wildlife, and humans. (Please refer to pages 12 - 14 of the "Biological Monitoring Parameters" section of this report for a more detailed explanation regarding cyanobacteria).

#### > Table 4: pH

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is 6.5, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding

pH, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase lake/pond pH.

#### > Table 5: Acid Neutralizing Capacity

Table 5 in Appendix B presents the current year and historic epilimnetic ANC for each year the lake/pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

The Acid Neutralizing Capacity (ANC) of the epilimnion (the upper layer) continues to remain **low** (1.90 mg/L as CaCO<sub>3</sub>) and is **well below** the state mean of 6.7 mg/L (Table 5). Specifically, this means that the lake/pond is "**extremely vulnerable**" to acidic inputs (such as acid precipitation) and has a **lower** ability than many lakes and ponds in the state to buffer against acidic inputs.

#### > Table 6: Conductivity

Table 6 in Appendix B presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

#### > Table 8: Total Phosphorus

Table 8 in Appendix B presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae's ability to grow and reproduce. Please refer to page 17 of the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

#### > Table 9 and Table 10: Dissolved Oxygen and Temperature Data

Table 9 in Appendix B shows the dissolved oxygen/temperature profile(s) for the 2002 sampling season. Table 10 shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the "Chemical Monitoring Parameters"

section of this report for a more detailed explanation.

The dissolved oxygen concentration was **high** at all depths sampled at the deep spot of the lake/pond. As stratified lakes/ponds age, oxygen becomes **depleted** in the hypolimnion (lower layer) by the process of decomposition. Specifically, the loss of oxygen in the hypolimnion results primarily from the process of biological oxidation of organic matter (i.e.; biological organisms using oxygen to break down organic matter), both in the water column and particularly at the bottom of the lake/pond where the water meets the sediment. The **high** oxygen level in the hypolimnion is a sign of the lake's/pond's overall good health.

The dissolved oxygen concentration was greater than **100%** saturation at **5** and **6** meters at the deep spot on the date sampling event. Wave action from wind can also dissolve atmospheric oxygen into the upper layers of the water column. Layers of algae can also raise the dissolved oxygen in the water column, since oxygen is a byproduct of photosynthesis. Considering that the depth of the photic zone (depth to which sunlight can penetrate into the water column) was approximately **6** meters on this date (as shown by the Secchidisk transparency), and that the metalimnion (the layer of rapid decrease in water temperature and increase in density – a place where algae are often found) was located between approximately **5** and **8** meters, we suspect that an abundance of algae caused the oxygen super saturation.

#### > Table 11: Turbidity

Table 11 in Appendix B lists the current year and historic data for inlake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to page 19 of the "Other Monitoring Parameters" section of this report for a more detailed explanation.

The turbidity of the hypolimnion (lower layer) sample was elevated on the **August** sampling event (**8.8 NTUs**). This suggests that the lake/pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling. When the lake/pond bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting the hypolimnion sample, please check to make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

#### **DATA QUALITY ASSURANCE AND CONTROL**

#### **Annual Assessment Audit:**

During the annual visit to your lake/pond, the biologist conducted a "Sampling Procedures Assessment Audit" for your monitoring group. Specifically, the biologist observed the performance of your monitoring group while sampling and filled out an assessment audit sheet to document the ability of the volunteer monitors to follow the proper field sampling procedures (as outlined in the VLAP Monitor's Field Manual). This assessment is used to identify any aspects of sample collection in which volunteer monitors are not following the proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples that the volunteer monitors collect are truly representative of actual lake and tributary conditions.

Overall, your monitoring group did an **excellent** job collecting samples on the annual biologist visit this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the biologist to provide additional training. Keep up the good work!

#### Sample Receipt Checklist:

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if the volunteer monitors followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, future reoccurrences of improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did an *excellent* job when collecting samples and submitting them to the laboratory this season! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the laboratory staff to contact your group with questions, and no samples were rejected for analysis.

#### Notes

- ➤ **Monitor's Note (6/18/02):** Pair of loons observed. Sedimentation at the boat launch is still a problem. Water level is very high.
- ➤ Monitor's Note (8/18/02): No flow at the inlet or outlet. Lake level is very low (approximately 4" below the top of the dam.)

#### **USEFUL RESOURCES**

Changes to the Comprehensive Shoreland Protection Act: 2001 Legislative Session, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/sp/sp-8.htm

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or <a href="https://www.des.state.nh.us/factsheets/wmb/wmb-10.htm">www.des.state.nh.us/factsheets/wmb/wmb-10.htm</a>

The Lake Pocket Book. Prepared by The Terrene Institute, 2000. (internet: <a href="www.terrene.org">www.terrene.org</a>, phone 800-726-4853)

Managing Lakes and Reservoirs, Third Edition, 2001. Prepared by the North American Lake Management Society (NALMS) and the Terrene Institute in cooperation with the U.S. Environmental Protection Agency. Copies are available from NALMS (internet: <a href="www.nalms.org">www.nalms.org</a>, phone 608-233-2836), and the Terrene Institute (internet: <a href="www.terrene.org">www.terrene.org</a>, phone 800-726-4853)

Organizing Lake Users: A Practical Guide. Written by Gretchen Flock, Judith Taggart, and Harvey Olem. Copies are available form the Terrene Institute (internet: www.terrene.org, phone 800-726-4853)

Proper Lawn Care in the Protected Shoreland: The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or <a href="https://www.des.state.nh.us/factsheets/bb/bb-15.htm">www.des.state.nh.us/factsheets/bb/bb-15.htm</a>

Swimmers Itch, WD-BB-2, NHDES Fact Sheet, (603) 271-3503 or <a href="https://www.des.state.nh.us/factsheets/bb/bb-2.htm">www.des.state.nh.us/factsheets/bb/bb-2.htm</a>

Use of Lakes or Streams for Domestic Water Supply, WD-WSEB-1-11, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/ws/ws-1-11.htm


Water Milfoil, WD-BB-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-1.htm


Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm

## Appendix A: Graphs


## Stone Pond, Marlboro


Figure 1. Monthly and Historical Chlorophyll-a Results

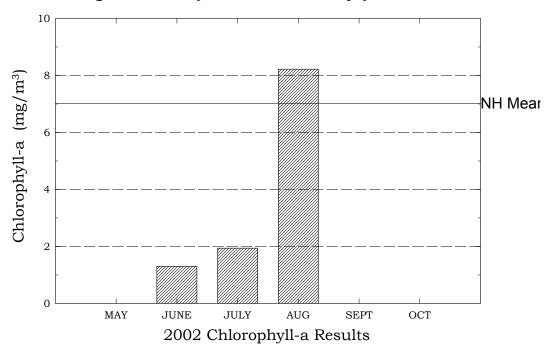

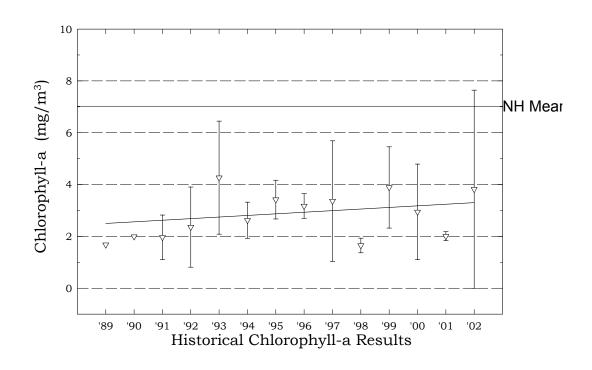

### Stone Pond, Marlboro

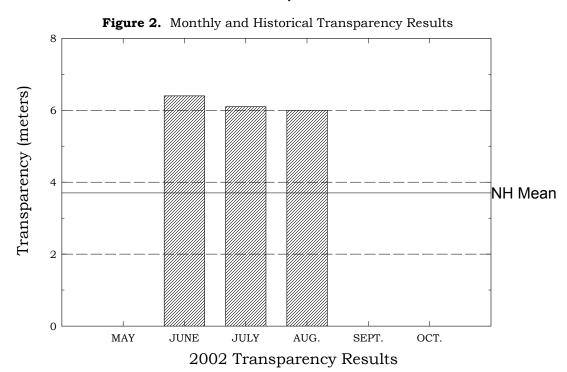

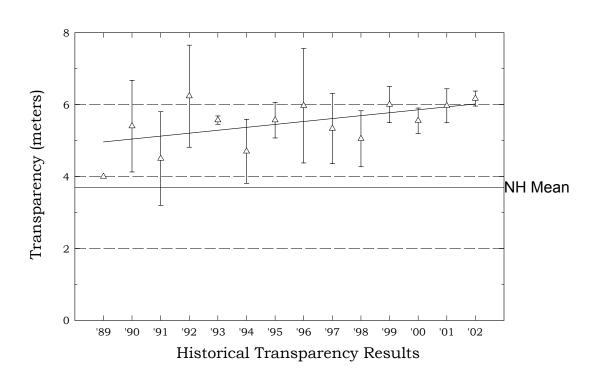

### Stone Pond, Marlborough

